


2. Inspect the electrodes and center porcelain for deposits, erosion or carbon fouling. If the erosion or deposit is heavy, replace the plug. Clean a carbon or wet-fouled plug with a plug cleaner, otherwise use a wire brush.
3. Measure with a feeler gauge and adjust to 0.8–0.9 mm (0.031–0,035 in.) (1) by bending the side electrode (2). Do not over tighten.

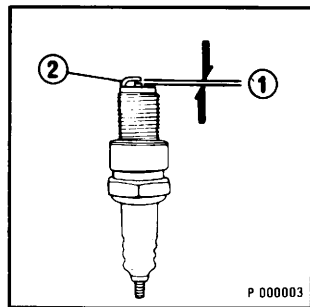

- 
2. Inspeccione los electrodos y partes en porcelana del centro para ver si haya depósitos, erosión o suciedad de carbón. Reemplace la bujía si esté excesivamente corroída o manchada. Utilice una escoba de bujía para limpiar la bujía o un cepillo de alambre; luego, limpie en una solución y séquela.
  3. Reajuste la separación de los electrodos a 0,8–0,9 mm (1). Mídala con un calibre de espesor y ajústela doblando el electrodo lateral (2) sólo. No apriete excesivamente.