


4. Check the chain slider (2) for wear.
If the depth of groove exceeds the limit,
the chain slider must be replaced. See
your Honda dealer.

Chain slider depth limit:

6 mm (0.2 in)

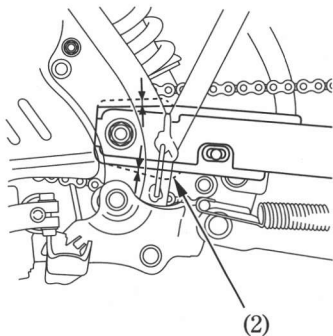

(2) Chain slider


5. Measure a section of the drive chain to determine whether the chain is worn beyond its service limit. Remove the drive chain and measure the distance between a span of pins from pin center to pin center. If the distance exceeds the service limit, the chain is worn out and should be replaced.

New Chain:

1,486 mm (58.5 in)

Service Limit:

1,516 mm (59.7 in)

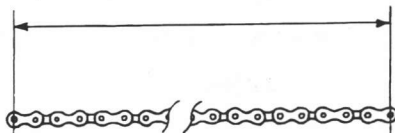

Measure a span of : 117 pins.