



Drive Chain

6. Check the chain roller (1) for wear and have it replaced if necessary. The chain roller must be replaced if it is worn to 1.5 mm (0.06 in). For replacement, see your Honda dealer.

LEFT SIDE

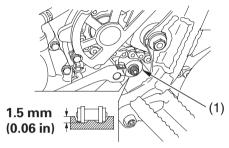

- (1) chain roller
- 7. Inspect the front and rear sprocket teeth for excessive wear or damage. If necessary, have your Honda dealer replace a worn sprocket.

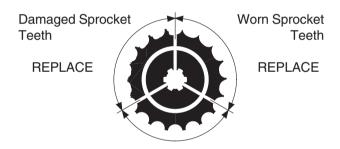

Normal Sprocket Teeth GOOD

NOTICE

Use of a new chain with worn sprockets will cause rapid chain wear.

Servicing Your Honda 155

